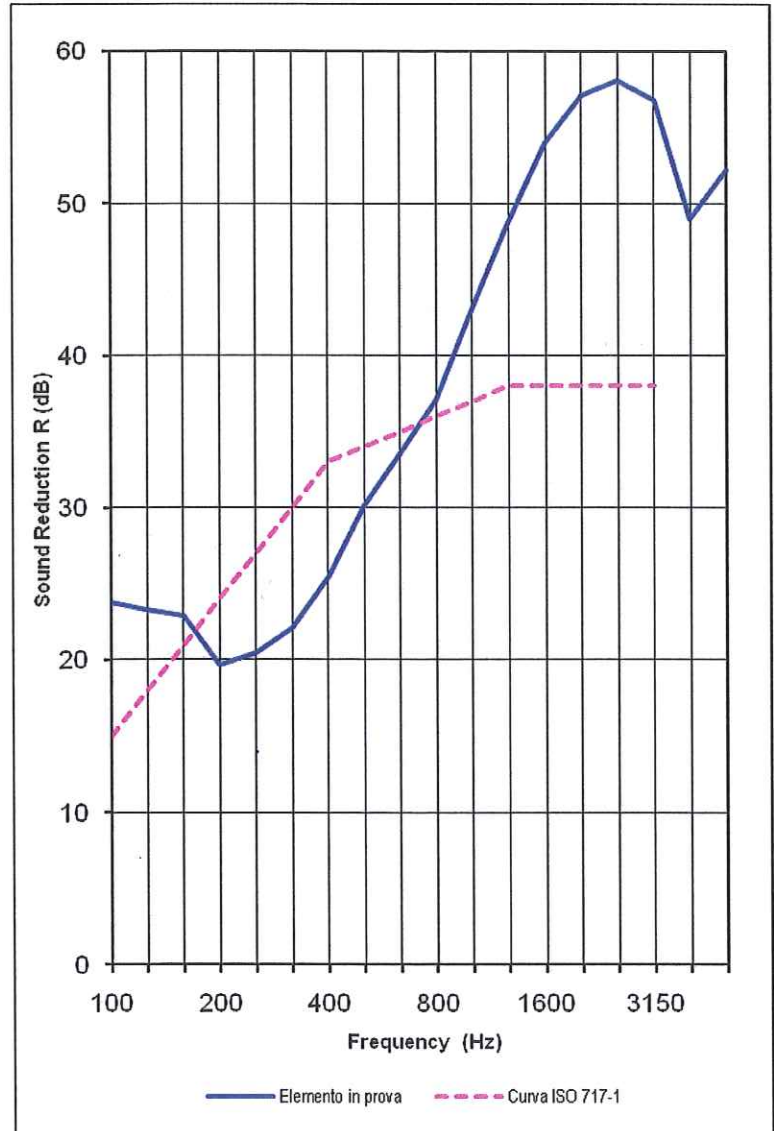


Tested element: SGG CLIMATOP 22-1SI (10 Ar) 3 (10 Ar) 3

 Specimen surface S = 1,88m<sup>2</sup>  
 Receiving room volume V = 86m<sup>3</sup>  
 Source room volume 98m<sup>3</sup>


FREQ. Hz	R dB
100	23,8
125	23,3
160	22,9
200	19,7
250	20,5
315	22,1
400	25,5
500	30,1
630	33,6
800	37,1
1000	43,2
1250	48,7
1600	54,0
2000	57,1
2500	58,1
3150	56,8
4000	49,0
5000	52,2

 $R_w(C;C_{tr}) = 34 (-1; -5) \text{ dB}$ 


Rating according to ISO 717-1 (in the band 100 ÷ 3150 Hz) based on laboratory measurements:

**IL RESP. Divisione Costruzioni**  
**Division Head**

Paolo Mele


**IL RESP. DEL CENTRO**  
**Managing Director**

Pasqualino Cau

